



FMC Corporation
Recreational Vehicle Division
333 Brokaw Road Box 664 Santa Clara, California 95052

☐ URGENT

☒ ROUTINE

☐ MANDATORY

☐ INFORMATIONAL

Service Bulletin

DATE 14 December 1973

NUMBER 2903 30002

ATTENTION: SERVICE MANAGERS			GROUP 3
1. <u>DESCRIPTION</u> This bulletin provides instructions for replacement of the roof mounted, hinged-type, AC condenser cover with a bolted-type cover.			SUBJECT REPLACEMENT OF HINGED-TYPE AC CONDENSER COVER WITH BOLTED-TYPE COVER
2. <u>EFFECTIVITY</u> This modification will be incorporated on coaches 00001 through 00349 whenever a replacement cover is required.			MODEL (S) AFFECTED 2900R
3. <u>MANPOWER</u> Estimated accomplishment time for one mechanic is 1 hour.			
4. <u>MATERIAL</u> Parts required to achieve this modification are as follows:			(Factory Use Only) Information added to:
<u>TITLE</u>	<u>RVD P/N</u>	<u>QTY PER COACH</u>	OWNER MANUAL (S)
Condenser cover assembly (bolted-type)	5101356-M01	1	
Attaching hardware			SERVICE MANUAL (S)
Screw	M14290 (1/4-20 x 5/8)	8	PARTS MANUAL (S)
Washer	M17024 (1/4 I.D. lock)	8	WARRANTY MANUAL (S)
Jacknut (molly fastener)	M17146 (1/4-20)	8	OTHER
5. <u>ACCOMPLISHMENT INSTRUCTIONS</u> The procedure for installing the bolted-type condenser cover assembly (P/N 5101356-M01) is as follows: a. Locate cover assembly by centering between two roof fairings and over condenser as illustrated in figure 1.			



FMC Corporation
Recreational Vehicle Division
333 Brokaw Road Box 664 Santa Clara, California 95052

☐ URGENT

☒ ROUTINE

☐ MANDATORY

☐ INFORMATIONAL

Service Bulletin

DATE 14 December 1973

NUMBER 2903 30002

ATTENTION: SERVICE MANAGERS

GROUP

3

SUBJECT

REPLACEMENT OF
HINGED-TYPE AC
CONDENSER COVER
WITH BOLTED-TYPE
COVER

MODEL (S)
AFFECTED

2900R

(Factory Use Only)
Information
added to:


OWNER MANUAL (S)

SERVICE MANUAL (S)

PARTS MANUAL (S)

WARRANTY MANUAL (S)

OTHER

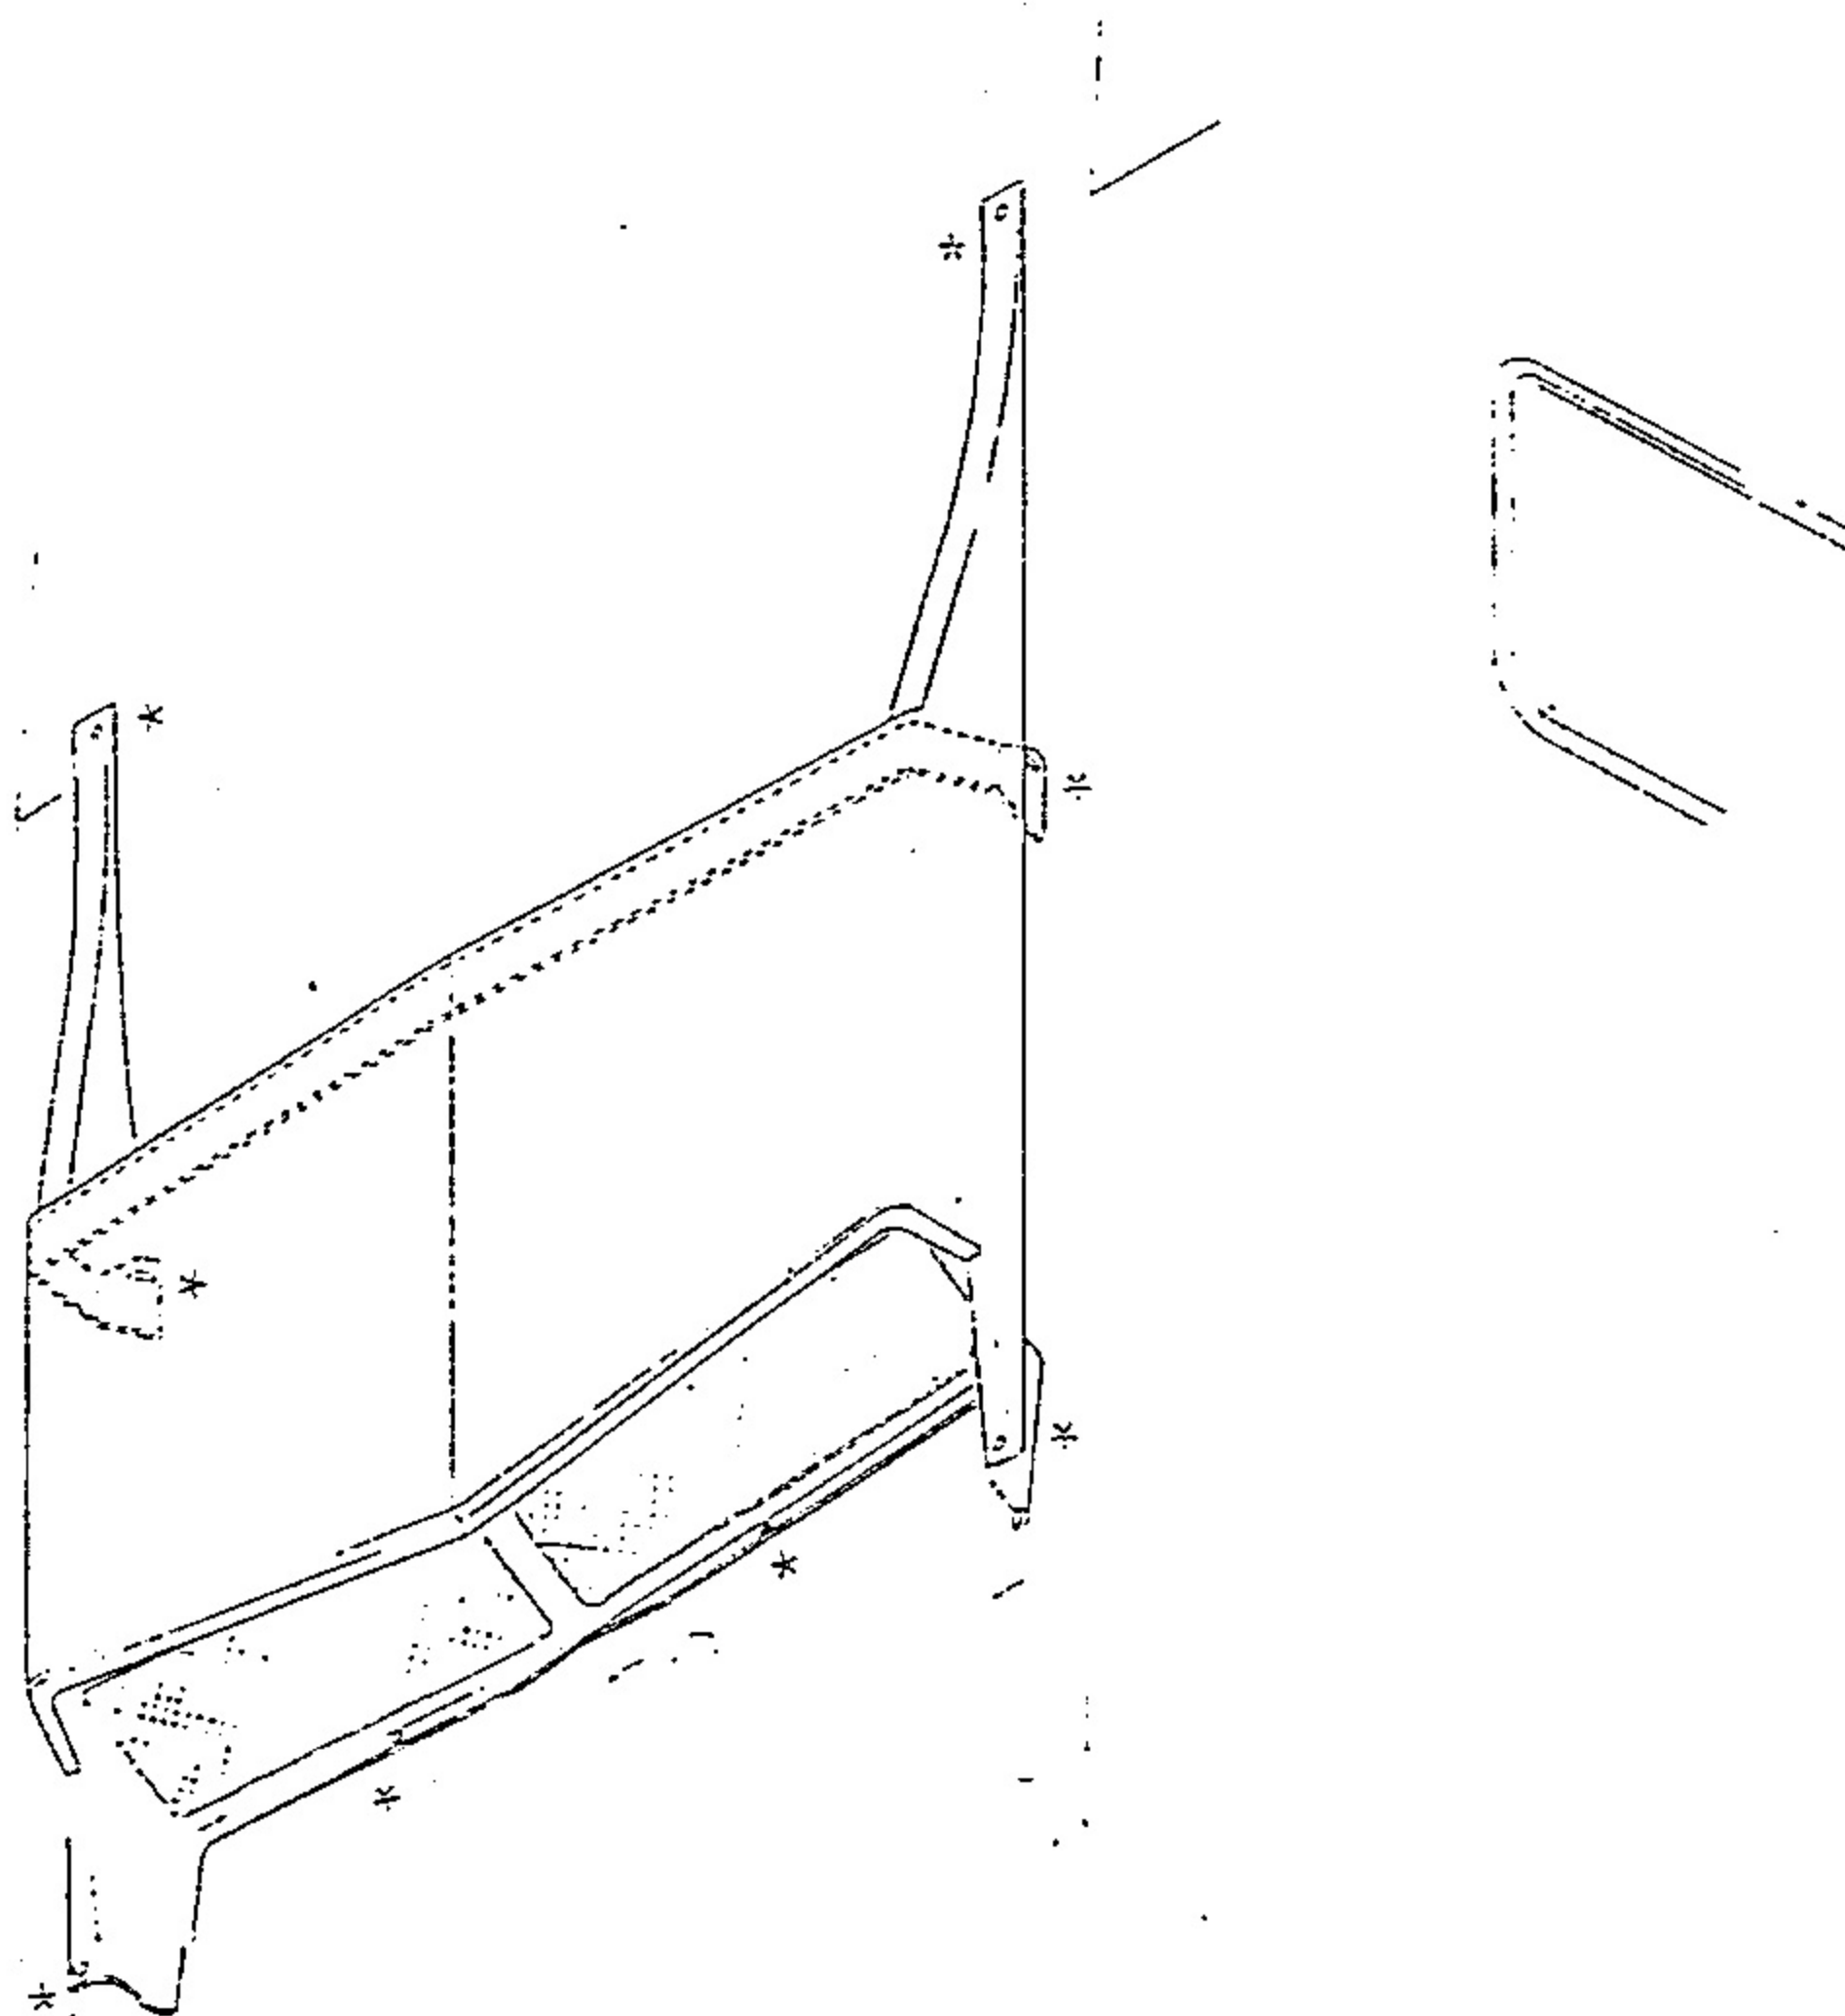

*Drill eight (8) places per instructions. Center cover assembly inside two roof fairings and over condenser.

FIGURE 1. A/C COVER INSTALLATION



FMC Corporation
Recreational Vehicle Division
333 Brokaw Road Box 664 Santa Clara, California 95052

☐ URGENT

☒ ROUTINE

☐ MANDATORY

☐ INFORMATIONAL

Service Bulletin

DATE 14 December 1973

NUMBER 2903 30002

ATTENTION: SERVICE MANAGERS	GROUP 3
<p>b. Using holes in cover assembly (8 places per figure 1) as a template, drill through roof (fiberglass only) with 9/32 inch diameter drill bit.</p> <p>CAUTION</p> <p>Do not drill beyond outer fiberglass shell thickness to avoid damage to interior lining material.</p> <p>c. Remove cover assembly and open up holes in roof to 7/16 inch diameter.</p> <p>d. Insert Jacknut M17146 ("molly" fastener) into each hole until anchor is flush with surface.</p> <p>e. Turn screw until snug in order to properly seat Jacknut M17146 ("molly" fastener), then remove screw.</p> <p>f. Position and align cover assembly and install screws with lockwashers (8 each) until tight as shown in figure 1.</p> <p><i>John L. Strever</i> JOHN L. STREVER Service Manager</p>	<p>SUBJECT</p> <p>REPLACEMENT OF HINGED-TYPE AC CONDENSER COVER WITH BOLTED-TYPE COVER</p> <p>MODEL (S) AFFECTED</p> <p>2900R</p> <p>(Factory Use Only) Information added to:</p> <p>OWNER MANUAL (S)</p> <p>SERVICE MANUAL (S)</p> <p>PARTS MANUAL (S)</p> <p>WARRANTY MANUAL (S)</p> <p>OTHER</p>